



Firmware Release Notes for Security Router models

- IE-SR-2TX-WL-4G-EU (Article No. 2682560000)
- IE-SR-2TX-WL-4G-US-V (Article No. 2682580000)

Note: Naming extension -V of US model stands for certified use of the Verizon cellular network additional to the other US cell phone providers.

Attention: Firmware versions since V1.67 and newer ones meet the **EU RED-DA cybersecurity requirements** (EN 18031-1:2024) related to RED Article 3.3(d) for products with connectivity functions that must prevent unauthorized access and misuse of data.

Before commissioning the device for the first time, we strongly recommend checking the installed firmware version and updating to the latest version, if a newer one is available for download from the Weidmüller website.

For information on bug fixes, implementation of new functions and other adjustments to previously released firmware versions, please read below release notes carefully.

Firmware update: If - after starting - the update process stops unintendedly during the initial file upload process file (does not upload 100% or stops after reaching 100%), the currently free RAM memory has reached a critical size for completing the firmware update process. In this case reboot the device (via Webpage 'Administration → Reboot' or Power down/up) to delete temporary files. Then repeat the firmware update process again.

Version 1.77 (RED DA compliant)

Release Date: September 04, 2026

Note: Regarding comparable features and bugfix status this firmware V1.77 corresponds to version V1.60 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- Mobile Interface Configuration: For parameter 'Allowed Networks Modes' the mobile networks (4G, 3G or 2G) now can be set in any group combination. Regarding the connection behavior, the fastest enabled network will be connected first. In case of unavailability or network error a network failover to the next fastest activated network automatically takes place.
- 'IP Filter (Local Access and Forwarding)':
 - Default Filter Policy: Naming of parameter 'Input WAN' changed to 'Internet / WAN Connection' for clear indication that this naming refers to the currently selected Internet/WAN connection (either *WAN Port*, *Mobile Interface* or *Wireless Client* configured on Web page 'Network Configuration → Internet/WAN Connection').
 - New interface name 'u-link' has been added to allow dedicated firewall settings for the Weidmüller u-link Remote Access Service.
 - Interface names 'TUN' and 'TAP' to be used for dedicated firewall rules in terms of OpenVPN connections have been combined to one interface named 'TUN/TAP'. This interface can be applied for firewall settings for any OpenVPN configuration using either a 'TAP' or 'TUN' interface.

Bug Fixes:

- Fix of security vulnerability 'Unauthenticated Remote Code Execution via Shell Injection in Web Management Interface' (CVE-2026-63586).
- Fix of security vulnerability 'SMS Password Authorization Bypass via Failed Attempt Counter' (CVE-2026-63587).
- The event log buffer (Diagnostics → Event Log) did not work properly as ring buffer according to the first-in/first-out principle. The buffer was frozen after reaching the limit of 200 kBytes.

- SNMP could not be activated after firmware update from any non-RED-DA compliant firmware version ($\leq$ V1.64) to a RED-DA compliant firmware (V1.67, V1.68 or V1.73) if SNMP was disabled when updating the firmware.
- 'IP Filter (Forwarding)':
 - A configured rule could not be taken over if the rule description contained a blank character.
 - Default Filter Policy 'Input LAN' did not work properly for value 'Reject' (LAN devices could have access to WAN/Internet side though restricted).
 - Defined rules did not work properly if 'WLAN' was for selected as interface.
 - A defined rule using value 'Any' for both incoming and outgoing interface did not work properly.
- 'Event Settings → Mail → Section *Send individual mails*': The status of sent mails now will be logged correctly and can be read via button 'Log'. Previously this mail specific log buffer did not contain any entry.
- 'Event Settings → SMS → Section *Send predefined SMS messages*': When sending the first alert message after configuration or after reboot or power-up, the first character of the sent message text was removed.
- The sending of the activated predefined mail alerts '*Digital Input/Output changed from Off to ON*' has been logged wrongly (Diagnostics → Event Log) after device startup though neither a DI nor DO change had triggered this event.
- The respective help pages accessible from the websites 'Bootloader Update' and 'IP Filter (Local Access and Forwarding)' have been corrected in terms of some typos.

Version 1.73 (RED DA compliant)

Release Date: November 21, 2025

Note: Regarding comparable features and bugfix status this firmware V1.73 corresponds to version V1.56 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- Implementation of security check that factory default password may not be set again.
- For configuring NAT rules (Destination and Source NAT) interface "PPPoE WAN" has been added as incoming interface.

Bug Fixes:

- Password changing did not work properly if encryption strength was set to 'weak'. The behavior was when setting a new 'weak' password it seemed to be accepted however the previous set password was still valid.
- Wrong display of the WLAN IP address on Web page 'System Information', if a DNAT rule with an additional virtual IP address has been configured.
- Bugfix regarding rekeying of a running IPsec connection.
- Bugfix regarding function 'Send individual mails based on received content from remote device': Connection to a configured mail server for sending a mail failed if the mail server's password contained character '&'.

Version 1.68 (RED DA compliant)

August 12, 2025

Note: Regarding comparable features and bugfix status this firmware V1.68 corresponds to version V1.52 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Bug Fixes:

- If the 'Masquerading' parameter was disabled when configuring the WAN port (to be used for hiding [NAT] of internal IP addresses by WAN-port IP), masquerading was also automatically disabled when using the 'Mobile Interface' for the Internet/WAN connection, even though both interfaces should not affect each other. This meant that devices connected to the LAN port could not establish communication with the Internet. Now for an Internet/WAN connection via 'Mobile Interface' function 'Masquerading/NAT' is always activated. This bug only affected previous version V1.67.

Version 1.67 (RED DA compliant)

July 31, 2025

Note: Regarding comparable features and bugfix status this firmware V1.67 corresponds to version V1.52 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- New user accounts 'user' and 'guest' added additionally to existing user 'admin' (Full rights administrator). Can be configured on Website 'Administration → System Settings'.
 - Rights of account 'user': Access/Change of Webpages 'System Info', 'Interface Configuration', 'Network configuration', 'Reboot', 'Diagnostics' and 'Save Configuration' including submenus.
 - Rights of account 'guest': Read-only access to Webpages 'System Info' and 'Diagnostics'.
- Note:** After update to V1.67 (or later) from any previous version before V1.67 and taking over the current configuration (no reset to factory defaults), there is no change in terms of user management. Existing 'admin' account is working as before, new accounts 'user' and 'guest' are disabled by default. They can be activated on Webpage Administration → System Settings.
- For a device having factory default settings the default 'admin' password must be changed at first login to ensure legal access security. Accounts 'user' and 'guest' are disabled by default.
- New levels for required cryptographic password strength added (Strong, Medium, Weak). By default, the strong encryption level is set and recommended for use.
- Implementation of a 1-minute blocking time to access the Web interface after repeatedly (5 times) entering the password incorrectly to increase the access security.
- SNMP: Now versions SNMPv1, SNMPv2c and SNMPv3 are supported. Due to security requirements SNMP is disabled by factory default.
- New feature 'DDoS Protection' (Distributed denial-of-service) added for protection against incoming traffic flooding (Webpage Firewall Settings → DDoS Prevention).
- New 'Event Log' (additional to existing 'System Log') added to monitor user- and security-related events.
- Firmware updates (up- or down-grades) starting on a device running a RED DA compliant firmware (V1.67 or newer) require an additional checksum file (provided together with firmware file) to ensure the data integrity of the firmware file.

Note: If - for any reason - a downgrade is necessary to any previous version before the first RED DA compliant version V1.67 please contact the Weidmüller support for getting the "old" firmware version and the associated checksum file.

Bug Fixes:

- Feature '**Send individual SMS messages based on received content from remote device**': The Router's status response message ('0' + <CR><LF> or 'xxx' + <CR><LF>) after receiving the "SMS Send information" was mistakenly divided into 2 TCP packets (first with

status '0' or 'xxx', second contained <CR><LF>). Now it behaves according to the definition. For more information click 'Help' on Router Webpage 'Event Settings → SMS'.

- Feature **'Send individual Mails based on received content from remote device'**: The Router's status response message ('0' + <CR><LF> or '1' + <CR><LF>) after receiving the "Mail Send information" was mistakenly divided into 2 TCP packets (first with status '0' or '1', second contained <CR><LF>). Now it behaves according to the definition. For more information click 'Help' on Router Webpage 'Event Settings → Mail'.

Version 1.64

Release date: June 12, 2025

Note: Regarding comparable features and bugfix status this firmware V1.64 corresponds to version V1.49 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- Enhancement of runtime stability by implementation of a control function for limiting tasks against excessive memory usage and too high processor load.
- Implementation of new feature **'Send individual SMS messages based on received content from remote device'**: Via this feature any smart device can transfer a simple data string (containing all SMS relevant information) to the Router (either via serial interface or TCP connection) to generate and send an SMS message with individual text and target phone number.
- Implementation of new feature **'Send individual Mails based on received content from remote device'**: Via this feature any smart device can transfer a simple data string (containing all relevant information of a mail) to the Router (either via serial interface or TCP connection) to generate and send a mail with individual text and recipient address.
- Website 'Administration → System Settings': Checkbox 'Redirect to HTTPS' has been added to force a secure login into the Router's Web interface using HTTPS.
- Website 'VPN → Files / Certificates': If a file without an extension will be uploaded to directory 'Other Files (Directory /etc/files/)' then for such a file the action buttons 'View' and 'Download' will be removed. This prevents getting the content of the stored file, for example due to security reasons.

For example, by storing a file with name 'username_password' in /etc/files it can be used to secure (not readable) the configured 'username' and 'password' for OpenVPN option 'auth-user-pass' (Configure: auth-user-pass /etc/files/username_password).

- Website 'Firewall Settings → IP Filter (Local Access)': Parameter **'Prioritization over Device Access Rules (Http[s], Telnet, SSH)'** has been added additionally for creating custom filter rules. All configured rules with enabled priority will be applied topmost over
 - the general device access rules (Http[s], Telnet, SSH, to be enabled/disabled via checkboxes on web page 'Administration → System Settings'),
 - non-prioritized custom rules,
 - and default policy rules.

For example, this allows to configure an IP-specific device access, if necessary for security reasons.

Bug Fixes:

- If the Router was running as 'Wireless Client' (Internet/WAN Connection) and a DNAT rule on WLAN interface with an additional virtual IP has been configured, then this virtual IP has been shown on website 'System Information → System Overview' instead of the real WLAN IP address.

- VPN IPsec: An established VPN connection was not re-established automatically, if the connection temporarily was interrupted by the VPN peer (for example after reboot of the VPN peer device). The Router needed to be rebooted also, then everything worked properly again.
- Website 'Administration → Firmware Update': Name of selected update file could not be seen completely. For example, after file selection a user could not verify if the version number contained in the selected file name, was the right one which he wanted to select.

Version 1.62

June 10, 2025

Bug Fixes:

- Elimination of security vulnerability **CVE-2025-41661**. Issue: Possibility of arbitrary command injection in Main Web Interface (Endpoint event_mail_test).
Solution: 1. Remove of the eval command.
2. Check the input validity of SMTP / Port / Sender and the three Receiver fields to prevent illegal input.
- Elimination of security vulnerability **CVE-2025-41662**. Issue: Possibility of arbitrary command injection in Main Web Interface (Endpoint tls_iotgen_setting).
Solution: Remove of the eval command.
- Elimination of security vulnerability **CVE-2025-41663**. Issue: Possibility of arbitrary command injection resulting in a stack buffer overflow in the u-link Management API.
Solution: Check input validity of Network / Subnet and Gateway fields to prevent illegal input.

Version 1.60

Release date: February 24, 2025

Note: Regarding comparable features and bugfix status this firmware V1.60 corresponds to version V1.48 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Adaptions / Improvements:

- New function "Bootloader update" has been implemented.
 - After firmware upgrade new parameter "Bootloader version" is shown in Webpage "System Overview" → Section "System Data". Additionally new tree menu item "Bootloader Update" has been added in section "Administration".
 - General information why updating the bootloader to a version $\geq$ V1.5 could be necessary:
 - On routers with bootloader version V1.4 both RJ45 ports (LAN and WAN) behave like an **unmanaged 2-Port Ethernet switch for around 45 seconds after power-up**. This can lead to unwanted (uncontrolled) forwarding of network traffic from LAN to WAN port and vice versa. For example, any DHCP broadcast request incoming at LAN port at this early power-up time can arrive a possible DHCP server located at WAN port side. This would result in DHCP offers back to LAN devices, though normally they should get an IP address from a LAN DHCP server after power-up.
 - After update to bootloader version V1.5 both RJ45 ports (LAN and WAN) are blocked immediately at power-up time and will take over their intended role according to the saved configuration during the boot process.

Version 1.58

Release date: June 12, 2024

Note: Regarding comparable features and bugfix status this firmware V1.58 corresponds to version V1.45 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- Menu Network Services --> Date & Time / NTP: Parameter "Synchronise" in section "NTP time synchronization" has been removed. This parameter was used to set the synchronization interval of the Real-time clock with the Router's "System Time". This "internal" behaviour now is set to 60 minutes.

Bug Fixes:

- Internal Supercap-buffered Real-time clock now will be synchronised by the Router's "System Time" each time when the "System Time" will be changed, either by manual setting (Menu 'Network Services --> Date & Time / NTP') or by periodic update via NTP request. This keeps the Router's "System Time" up-to-date after power-up, unless the Router is not powered-off for longer than around 7 days. Then the RTC needs to be re-charged at next Router power-on. If this duration will be exceeded, means the storage energy of the supercapacitor is used up, then the Router's "System Time" will be set at next power-up by the initial RTC time 'Sat Jan 1 2022 00:00:00 (UTC)'.

The previous behaviour was, that the RTC only has been set by the "System Time" after a reboot (Warm start). This could lead to a wrong value of the Router's "System Time" when taken over from RTC at power-up and no NTP service was configured or not accessible.

Version 1.57

Release date: April 17, 2024

Note: Regarding comparable features and bugfix status this firmware V1.57 corresponds to version V1.43 of router model without integrated cellular modem (IE-SR-2TX-WL / Article No. 2682590000).

Feature Enhancements / Updates:

- Improved registration and connectivity procedure for establishing an Internet connection to mobile operators.
- Improvement of 'Mobile Interface' configuration (additional hints and check of configuration settings).
- Menu Event Settings → E-Mail: Parameter 'Secure Mode' for SMTP server settings extended by additional selection value 'STARTTLS'.
- Menu Event Settings → E-Mail: Implementation of function 'Send Testmail' to send a pre-defined test mail based on the configured mail server settings to evaluate if properly configured.

Bug Fixes:

- Mobile Interface connection: Manual swapping between selectable profiles SIM1 and SIM2 and establishing an Internet connection automatically (Connection mode 'permanent') could fail due to a network registration problem with the operator belonging to the activated SIM.
- When restoring the configuration from a backup file (created with another router of the same type) the MAC addresses (LAN and WAN port, not WLAN) of the target router were overwritten with the MAC addresses of the router from which the backup file was created. If this happened, original MAC addresses could be restored by doing a reset to factory default settings.
- Serial interface configuration: Only 7 data bits could be set (instead of 7 or 8 data bits).
- Possible loss of general WLAN function after direct change from operation mode 'Wireless Client' to 'Access Point' (instead of disabling WLAN first, then enabling WLAN again and

selecting Access Point'). Resulting, menu 'System Overview' did not show any SSID, the configured SSID was not visible by WLAN clients and in system log has shown that the WLAN interface was not found. A reset to factory settings was necessary to get the WLAN interface working again.

- If WAN / Internet Connection was set to 'Wireless Client' then not all active routes were pushed to the u-link Portal.
- Menu Firewall Settings → IP Filter (Local Access): Setting value 'Accept' of 'Default Filter policies' for 'Input LAN' and 'Input WAN' did not allow any input communication without restrictions.
- Menu Event Settings → Digital I/O: Wrong behaviour of digital output for event type 'Status Mobile Connection'. DO did not change when mobile connection has been toggled (connected / disconnected) via actions 'Start/Restart Connection' and 'Disconnect' in menu System Information → Status Mobile/4G.
- Menu Network Services → DHCP: No effect on tree menu item 'DHCP' (Expand or collapse sub menus) if 'Plus' or 'Minus' character has been clicked. It was always expanded.
- Menu System Information → System Overview: Correction of wrong status display of parameter 'DHCP Server'. Status of enabled 'DHCP Server' was shown as disabled.
- Menu System Information → System Overview: Correction of wrong status display of parameter 'Port Settings' for RJ45-Ports LAN and WAN if only the WAN port was connected. In this case both 'Port Settings' have wrongly shown status '10 half duplex'.

Version 1.50

Release date: December 04, 2023

Feature Enhancements / Updates:

- u-link Remote Access Service: The registration process (getting a certificate) for connection to the u-link VPN Server has been updated to Public Key Infrastructure (PKI) Version 3.
 - Note: If the Router shall be used for u-link remote access and - from now on - needs to be registered on the u-link portal, it is mandatory to update the firmware to this version V1.50 or later. A registration process based on previous version PKI V2 (4G-Router firmware versions < V1.50) no longer will be accepted by the u-link Web portal. Already registered Routers are not affected but it is recommended to update to new firmware due to here listed updates and bug fixes.
- Menu Network Services → DHCP → DHCP Services: For 'DHCP Server' configuration new parameter 'Subnet Mask' has been added.
- Improvement of OpenVPN configuration when configuring a client or server instance via text based OpenVPN option settings.
- Menu System Information → Status Mobile/4G: Phone number of inserted (active) SIM now is displayed in the status window.
- Menu Event Settings → SMS: Improvement when entering mobile numbers to be used for SMS alerts and control messages.
- Menu Administration → Backup and Restore: A backup configuration file now contains also uploaded files and certificates (Menu VPN → Files / Certificates) to be used for VPN connections. In earlier versions these files needed to be imported additionally after restoring a configuration backup file.

Bug Fixes:

- u-link Remote Access Service: Defined static routes (Menu Network Services → Routing) now can be pushed to the u-link VPN Server to allow access of u-link Service-PCs to those networks via the Router.

- Menu Firewall Settings → IP Filter (Forwarding): An added rule was not taken over into the “Active IP Filter List” after applying if the rule description contained a blank character.
- Menus NAT Settings → Destination and Source NAT: If more than 8 NAT rules have been added then after applying a NAT rule could disappear or could be relocated to another position inside of the rule list. This issue was caused by a wrong index setting.
 - Workaround for restoring a configuration file (containing NAT rules) which was created by a firmware earlier than V1.50:
 1. After finishing the restore process select menu NAT Settings → Destination NAT. Then simply click button ‘Apply’ to apply the imported rules (listed in Active Forwarding Table). By doing this the imported rules internally will be reorganized according to a new table structure introduced in firmware version V1.50.
 2. Select menu NAT Settings → Source NAT and simply click button ‘Apply’ to apply the imported rules (listed in Active SNAT Table) due to same reason as done for DNAT rules.
 3. Due to these changes you need to save the configuration again and to create a new backup file if necessary.
- Menu System Information → System Overview: Correction of wrong status display in section ‘u-link / OpenVPN’ if connected as ‘OpenVPN Client’ (has shown ‘Disconnected’ instead of ‘Connected’).
- Menu VPN → OpenVPN: Correction of wrong status display on tab ‘Activation / Status’ if connected as ‘OpenVPN Client’ (has shown ‘Connecting’ instead of ‘Connected’).

Version 1.45

Release date: August 15, 2023

Feature Enhancements / Updates:

- New service mode ‘LTE Modem Communication’, selectable for the serial interface for direct access and control of the integrated LTE modem via AT commands. When activated, the serial port acts as a transparent interface for AT command communication between the LTE modem and any connected serial device. Primarily this feature is intended to allow smart devices connected to the Router’s serial interface sending any kind of SMS messages via the Router.
- NAT Settings: Additional to OpenVPN interface type ‘TUN’ now Interface ‘TAP’ can be selected for both DNAT (Incoming Interface) and SNAT (Outgoing Interface).
- OpenVPN: When configuring a pre-defined routed connection type (Routed-Point-to-Point Connection or Routed-Multi-Client Connection) for parameter ‘Interface Type’ now ‘TAP’ can be selected additional to ‘TUN’ (default).
- Extension of Web menu ‘System Overview’ with new section ‘u-link / OpenVPN’ showing the status of an active VPN instance (either u-link, OpenVPN Server or OpenVPN Client).
- For WLAN password (Shared Key) the use of blank characters (space) now is allowed for both modes ‘Wireless Client’ and ‘Access Point’.

Bug Fixes:

- If a configuration PC was connected to the Routers WAN port and the Web interface was accessed via WAN port IP and if any parameter in menu ‘Interface Configuration → LAN/WAN Port’ (e.g., LAN IP, Gateway or DNS entry) has been changed, then after applying the Web interface automatically was redirected to the LAN port IP.
- DNAT Settings (Forwarding): A configured ‘Port Forwarding’ rule using destination port 80 (www) has overruled other configured ‘Port Forwarding’ rules.

- IP Filter (Local Access): When configuring a rule, the entered values of parameter 'Source IP / Netmask' sometimes are not taken over correctly into the 'Active IP Filter List (Local Access)'. Resulting in showing wrong entries like 'xxx.xxx.xxx.xxx/undefined' or 'Specify'.

Version 1.42

Release date: May 25, 2023

Bug Fixes:

- SMS Control function "Set Digital Output ON/OFF" had no effect if the Router has received a SMS text message (e.g., from a Smartphone) when using command `?DO=on` or `?DO=off`.
- For SMS Alert functions related to changes of DI and DO some special characters (like equal sign '=') were not allowed when entering a variable message text for DI / DO change.
- An SMS alert related to any DI / DO change now contains exactly the freely configurable message text. In the previous version the alert text still contained additionally the system name (prefixed).

Version 1.40

Release date: May 10, 2023

Bug Fixes:

- Support of blank characters added for WLAN SSID. Now allowed for both operation modes "Access Point" and "Wireless Client".
- Fix of u-link registration status display. Previously status "Registered" already was displayed though the registration process was not yet completely done.
- Adaption of u-link registration process in case of trying to register a used activation code. Previously the registration process restarted endless when a used activation code was entered.

Version 1.38

Release date: April 21, 2023

Feature Enhancements / Updates:

- Implementation of u-link VPN Client for use with Weidmüller u-link Remote Access Service. For configuration new menu item "VPN → u-link" has been added.
- Implementation of IPsec VPN configurable as Initiator (Automatic start) or Responder (Waiting). For configuration new menu item "VPN → IPsec" has been added.
- Additional Implementation of these Dynamic DNS Providers:
 - DuckDNS (duckdns.org)
 - NoIP (no ip.biz)
 - DynDNS Service (dyndnss.net)
 - GoIP (goip.de)
 - Dynu (dynu.com)
 - FreeDNS (freedns.afraid.org)
- Adapted behavior of signaling when pressing 'Reset' button. Pressing and holding reset button > 1 second and < 5 seconds initiates a reboot and sets LAN IP to factory default value 192.168.1.110. This is indicated by a short beep and fast blinking of LED 'DO'. Pressing and

holding reset button > 5 seconds initiates a reboot and resets the configuration to factory default values. This is indicated by two short beeps and fast blinking of LED 'DO'.

Bug Fixes:

- WAN port did not work properly (slow data throughput) when configured as additional (second) LAN port (applicable for Internet/WAN connections via Wireless Client or Mobile Interface).

Version 1.32

Release date: November 11, 2022

Bug Fixes:

- Wrong display of active SIM profile in menu 'Internet/WAN Connection' for a selected Internet connection via mobile interface (SIM1 was indicated to be the active profile instead of SIM2).
- Configuration 'Mobile Interface': An inserted locked SIM card could not be unlocked via 'Check' button in section 'Profile SIM'.

Version 1.31

Release date: October 27, 2022

Feature Enhancements / Updates:

- Adaption of OpenVPN configuration page for mode 'Configure via OpenVPN options' (Input windows now are resizable, additional information for configuration added).

Bug Fixes:

- Configured OpenVPN settings – when entered directly as OpenVPN options - could not be stored after applying.
- OpenVPN logging level selection 10 removed (OpenVPN logging supports only up to level 9).
- Status of OpenVPN client connection to an OpenVPN server now will correctly displayed.
- The selectable behavior for an activated OpenVPN instance (either being Server or Client) now will be done correctly (for example start/stop respectively connect/disconnect automatically at boot time or triggered by digital input).
- Event mail could not be sent when having a space character in parameter 'Sender name'.

Version 1.29

Release date: October 18, 2022

- Initial firmware version!