

Technical change to straight M12 cord sets with LED function

Dear Madam or Sir,

the below mentioned M12 cord sets with LED function will be changed from now on.

Please pass on this Product Change Notification (PCN) to your employees and, if applicable, to your customers.

1. General overview

Type of change:

short-term (executed within the next 6 months)
 normal (executed after 6 months)

Short-term action due to:

Software or firmware bugfix
 Short-term recall by supplier
 Product improvement

Delivery stop by supplier
 Force majeure
 other

Short-term action due to:

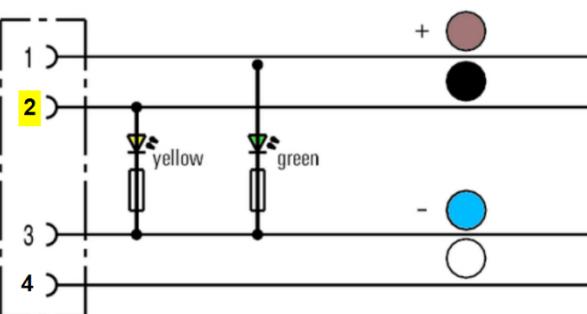
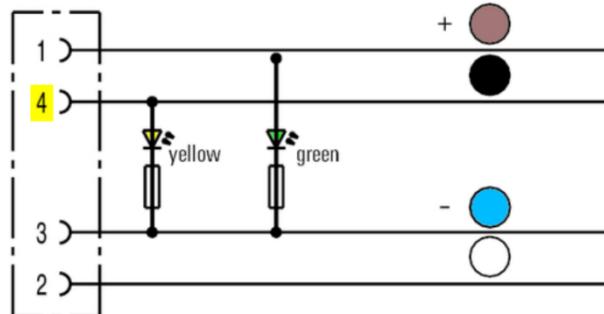
Faulty assembly of the LED on the inflowing printed circuit board

2. General information

With the previous assembly, the yellow LED lights up when there is a voltage supply between pin 2 and pin 3. According to the specification, however, the yellow LED should light up when there is a signal on pin 4.

3. Change details

The assembly of the printed circuit board is changed so that the yellow LED lights up when there is a signal from pin 4.

Old wiring diagram	New wiring diagram
	

For completeness: at the 3-pole versions the **white** wire is missing (pin 2 of new wiring is not connected).

4. Affected parts

Article number	Article description
1094190200	SAIL-M12BG-4-2L2.0U
1094190500	SAIL-M12BG-4-2L5.0U
1094191000	SAIL-M12BG-4-2L10U
1094192000	SAIL-M12BG-4-2L20U
1094192500	SAIL-M12BG-4-2L25U
1094193000	SAIL-M12BG-4-2L30U
1094194000	SAIL-M12BG-4-2L40U
1094195000	SAIL-M12BG-4-2L50U
2569900150	SAIL-M12BG-3L1.5TB
2569900300	SAIL-M12BG-3L3.0TB
2569901000	SAIL-M12BG-3L10TB
2700860500	SAIL-M12BG-4-2L5.0TB
2700861000	SAIL-M12BG-4-2L10TB

5. Timeline

With this letter we inform you that the change will be immediately implemented to the production.

We hope that the changes will benefit your business and will not affect you in any significant way. We apologise in case of any inconvenience caused. Please rest assured that we will do everything possible to achieve this product change as smoothly as possible with minimum or no business disruption.

We are very sorry for all the inconveniences caused and doing everything to adjust this product change as smooth as possible without big influence on delivery times and general functions.

For further questions please contact your sales office directly. All contacts for sales representatives are available here: <https://www.weidmueller.com/contact>

Details of this and any other product changes can also be found in our Support Center by following the link: <https://support.weidmueller.com/support-center/popular-resources/product-change-notifications>

Best regards

Product Management

Weidmüller Interface GmbH & Co. KG
Klingenbergsstraße 26 | 32758 Detmold | Germany
www.weidmueller.com