

MPS 5 – Change of top-fixation

Dear Madam or Sir,

Product adaptations serve the purpose of continuous product and/or process improvement. The listed products are delivered in a modified version. Please pass this product information on to your employees and, if needed, to your customers.

1. General Overview


Type of notification: ☒ PCN ☐ PDN ☒ Short-term action

Short-term action due to:

- | | |
|---|---|
| <input type="checkbox"/> Software / Firmware Bugfix | <input type="checkbox"/> Short term delivery stop by supplier |
| <input type="checkbox"/> Short term recall by supplier | <input type="checkbox"/> Force majeure |
| <input checked="" type="checkbox"/> Product improvement with customer benefit | <input type="checkbox"/> other |

2. Technical changes

The top fixation has been slightly contour modified with an operating edge. In addition, the lower bar has been optimized for a better performed unlocking. The dimensions of the top fixation remain unchanged, but the position of the top fixation on the product changes by 0.7 mm in the direction of the first pole.

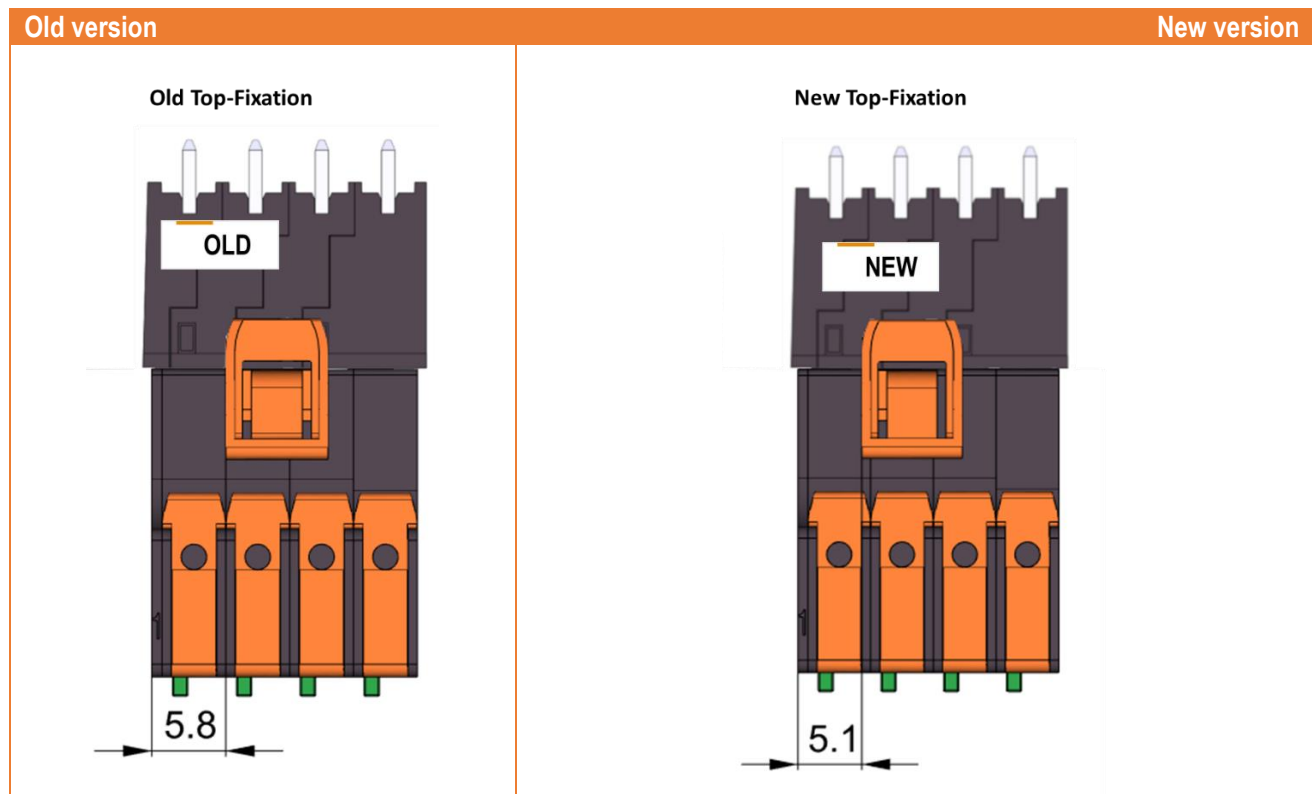

Old version

Min. front plate cut-out

12	55.00	2.165	25.90	1.020
11	50.00	1.969	25.90	1.020
10	45.00	1.772	20.90	0.823
9	40.00	1.575	20.90	0.823
8	35.00	1.378	15.90	0.626
7	30.00	1.181	15.90	0.626
6	25.00	0.984	10.90	0.429
5	20.00	0.787	10.90	0.429
4	15.00	0.591	5.90	0.232
3	10.00	0.394	5.90	0.232
2	5.00	0.197	0.90	0.035
n Poles	L1 [mm]	L1 [inch]	X [mm]	X [inch]

OLD

New version

Min. front plate cut-out

12	55.00	2.165	25.30	0.996
11	50.00	1.969	25.30	0.996
10	45.00	1.772	20.30	0.799
9	40.00	1.575	20.30	0.799
8	35.00	1.378	15.30	0.602
7	30.00	1.181	15.30	0.602
6	25.00	0.984	10.30	0.406
5	20.00	0.787	10.30	0.406
4	15.00	0.591	5.30	0.209
3	10.00	0.394	5.30	0.209
2	5.00	0.197	0.30	0.012
n Poles	L1 [mm]	L1 [inch]	X [mm]	X [inch]

NEW

3. Availability

With this letter we inform you that the change will be implemented immediately. There is no stock adjustment. Therefore, mixing of variants may occur, but not in one packaging unit.



4. Affected parts

The MPS 5 product family is affected by this change. The part numbers affected are listed below:

Material number	Short text for material
2741670000	MPS 5/02 S F1 TN B B
2741680000	MPS 5/03 S F2 TN B B
2741690000	MPS 5/04 S F2 TN B B
2741700000	MPS 5/05 S F3 TN B B
2741710000	MPS 5/06 S F3 TN B B
2741720000	MPS 5/07 S F4 TN B B
2741730000	MPS 5/08 S F4 TN B B
2741740000	MPS 5/09 S F5 TN B B
2741750000	MPS 5/10 S F5 TN B B
2741760000	MPS 5/11 S F6 TN B B
2741770000	MPS 5/12 S F6 TN B B

5. Data

Except for the geometry, all technical data and functional features will not be affected by this change. Approvals and permits remain valid unchanged. Detailed information on the technical data can be found for the products in the online catalog.

We are very sorry for all the inconveniences caused and doing everything to adjust this product change as smooth as possible without big influence on delivery times and general functions.

For further questions please contact your sales office directly. All contacts for sales representatives are available here:

<http://www.weidmueller.com/contact>

Weidmüller will see this notification as accepted unless a separate procedure is requested in writing within 30 days of the issue date.

Best regards

Product Management

Weidmüller Interface GmbH & Co. KG

Klingenbergstraße 26 | 32758 Detmold | Germany

www.weidmueller.com