

Technical change to SAIL-VSA-X.XU-230 (189100XXXX)

Dear Madam or Sir,

The products listed below will be changed after a transition period. Please pass on this Product Change Notification (PCN) to your employees and, if applicable, to your customers.

1. General overview

Type of change: ☒ **short-term** (executed within the next 6 months)
☐ **normal** (executed after 6 months)

Short-term action due to:

- | | |
|--|---|
| <input type="checkbox"/> Software or firmware bugfix | <input checked="" type="checkbox"/> Delivery stop by supplier |
| <input type="checkbox"/> Short-term recall by supplier | <input type="checkbox"/> Force majeure |
| <input type="checkbox"/> Product improvement | <input type="checkbox"/> other |



Short-term action due to:

Ensuring the availability of the items listed below.



2. Change details

Due to a spontaneous discontinuation of the circuit board, the connector design had to be modified. This resulted in changes to the dimensions and arrangement of the contacts.

Dimensions Old

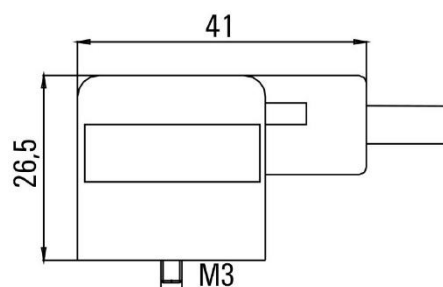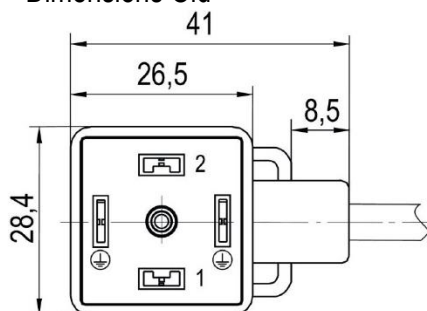


Dimensions Old

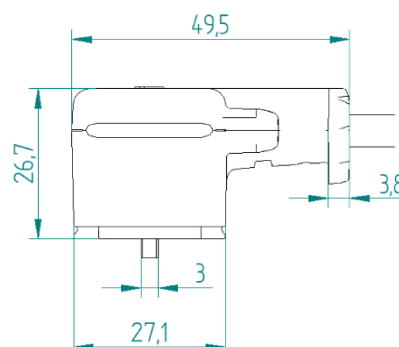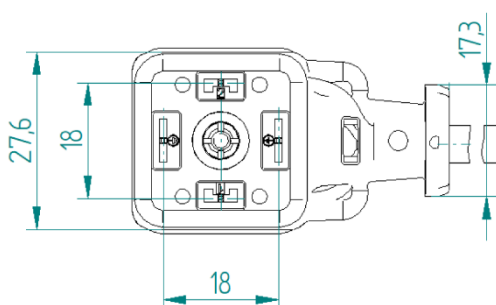


Due to a change in the connector design, the varistor installed in the articles can only be installed with the contact carrier rotated by 180°, as otherwise errors in series operation are to be expected. For this reason, pin 1 and pin 2 are swapped.

Pin assignment old

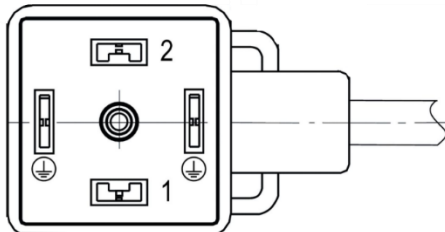

Pin assignment new

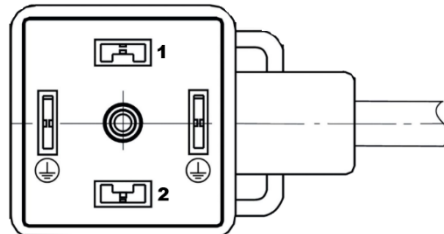

Since the pin assignment is permanently installed on the contact carrier in the tool, it will remain identical to the old version. Therefore, please note the following change in the assignment of the wire colors of the connection cable:

Pin	Aderfarbe Bisher/ Wire Color Old	Aderfarbe neues / Wire Color New
1	Braun / Brown / BN	Blau / Blue / BU
2	Blau / Blue / BU	Braun / Brown / BN
PE	Grün Gelb / Green Yellow / GN YE	Grün Gelb / Green Yellow / GN YE

There are no further changes to the technical data and approvals.

3. Affected parts

Materialnumber	Name
1891000150	SAIL-VSA-1.5U-230
1891000500	SAIL-VSA-5.0U-230
1891000750	SAIL-VSA-7.5U-230
1891001000	SAIL-VSA-10U-230
1891001500	SAIL-VSA-15U-230

4. Timeline

The change will be implemented in production immediately to ensure that the items can be delivered.

We hope that the changes will benefit your business and will not affect you in any significant way. We apologise in case of any inconvenience caused. Please rest assured that we will do everything possible to achieve this product change as smoothly as possible with minimum or no business disruption.

For further questions please contact your sales office directly. All contacts for sales representatives are available here: <https://www.weidmueller.com/contact>

Details of this and any other product changes can also be found in our Support Center by following the link:
<https://support.weidmueller.com/support-center/popular-resources/product-change-notifications>

Best regards

Product Management

Weidmüller Interface GmbH & Co. KG

Klingenbergstraße 26 | 32758 Detmold | Germany

www.weidmueller.com

in    