


WI-MOD-415-E-C

Wireless Mesh Modem and Gateway Installation Guide

Antenna installation

When selecting an antenna, consider radio proximity.
Use Figure 1 as a guide for installing an antenna and attaching it to the WI-MOD-415-E-C.

Figure 1. Antenna installation

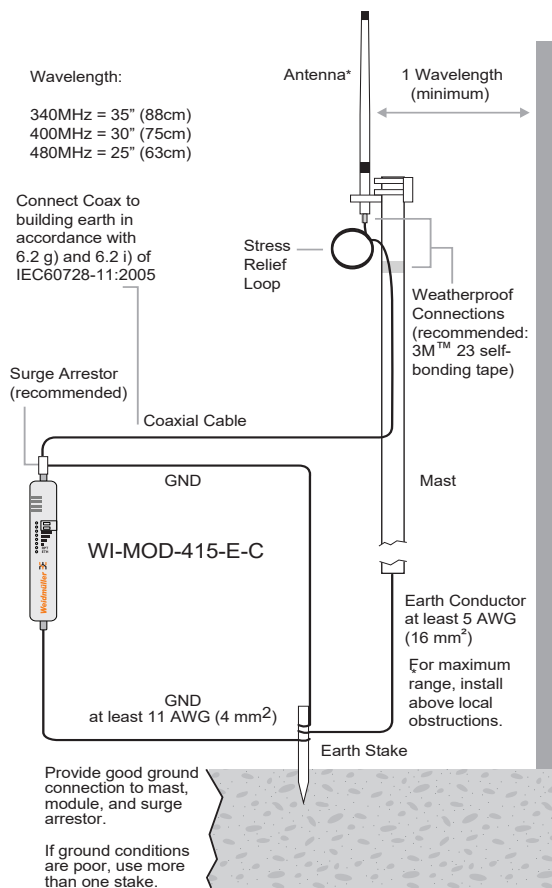

Connecting to the module for configuration

- Download and install configuration application "CConfig" from the Weidmüller website www.weidmuller.com
- Connect to PC using supplied USB cable
- Connect to the device at 192.168.111.1
Or 1.1.1.1 (firmware v2.4)
- The PC will be automatically assigned an IP address via DHCP

Username: user


Password: user

WI-MOD-415-E-C Wireless Mesh Modem and Gateway Installation Guide

NOTE

All connections must be SELV <50 Vac and <60 Vdc.


The following illustrations show the ports on the WI-MOD-415-E-C.

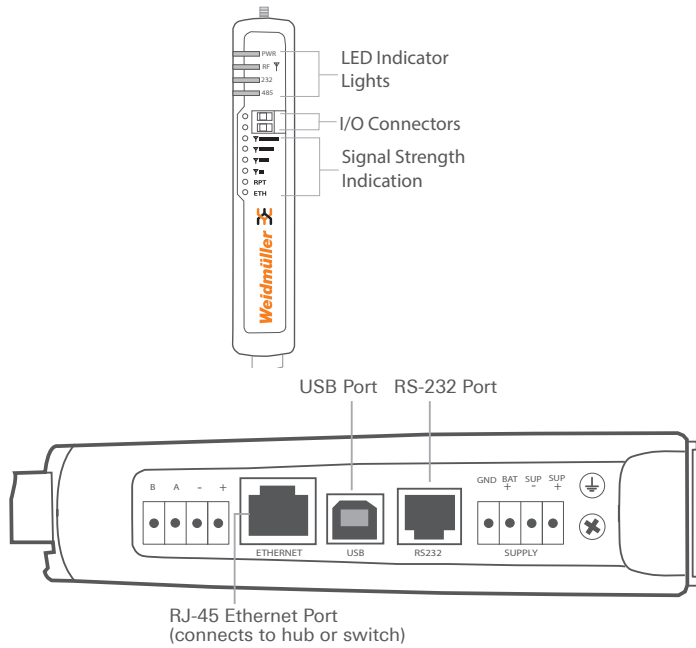

Configuration switches

Use the DIP switches in the side access panel to select default configuration settings.

DIP	DESCRIPTION
1	Unused
2	Enables default configuration

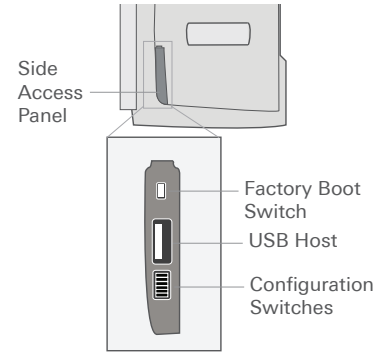

Input and output connections


The digital input/output channels can be wired as inputs or outputs.

Power supply wiring

The ground (GND) and "SUP -" terminals are connected internally to the ground terminal and to the module enclosure.

Connect the screw terminal on the end plate to ground for surge protection.


Refer to user manual for RF duty cycle derating when powering the module from SUP+ and SUP- terminals.

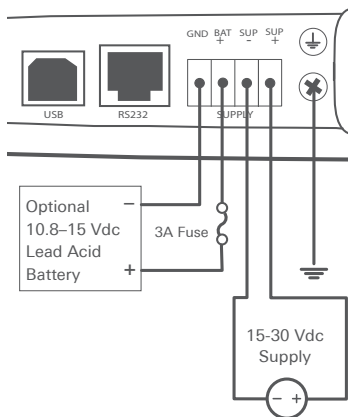


Expansion I/O power and RS-485 serial connection

An on-board RS-485 terminating resistor provides line termination for long runs.


Enable terminating resistors at far end of the RS-485 cable.

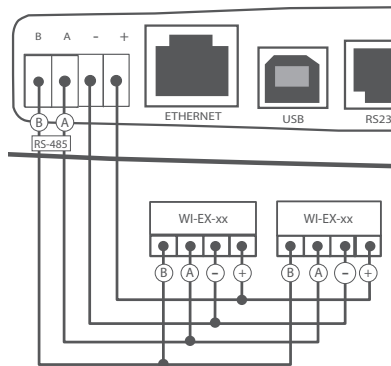


High speed pulsed input

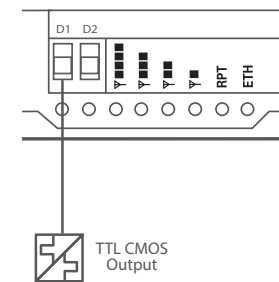

Digital input

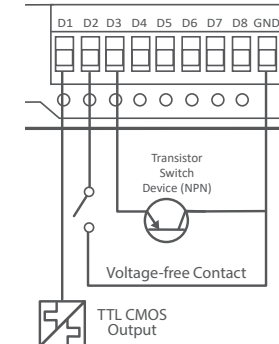

Digital output

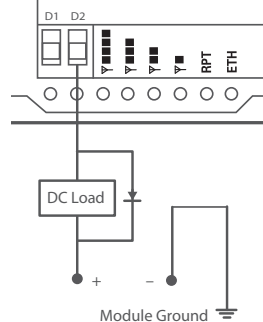

Weidmuller USA
821 Southlake Boulevard
Richmond, Virginia 23236
Main: 804.794.2877
Customer & Technical Support: 1 800.849.9343
Fax: 804.794.0252
info@weidmuller.com / support@weidmuller.com
www.weidmuller.com

Weidmuller Canada
10 Spy Court
Markham, Ontario L3R 5H6
Main: 905.475.1507
Toll Free: 1 800.268.4080
Toll Free Fax: 1 877.300.5635
Fax Admin: 905.475.5855
info1@weidmuller.ca / support@weidmuller.ca
www.weidmuller.ca

Weidmuller Mexico
Blvd. Hermanos Serdán 698
Col. San Rafael Oriente
Puebla, Puebla, Mexico
C. P. 72029
Main: 01 222 2686267
Fax: 01 222 2686219
clientes@weidmuller.com.mx
www.weidmuller.com.mx

