

Technical change of the housing of the FrontCom® Micro

Dear Madam or Sir,

the products listed below are subject to a product change and will be supplied in a modified revision. Please pass this product information on to your employees and, if needed, to your customers. All modifications mentioned have been made to support our ongoing commitment to continual improvement and ongoing product development.

1. Initial situation

The insert is mounted in the housing of the FrontCom® Micro from the side without the protective cap. The insert is also removed from this side by bending the fixing clips to the side with two screwdrivers and pulling the insert out. The interface can be mounted with a wall thickness of 1-3 mm.

2. Technical change

The design on the side of the protective cap including the type of latching of the insert has been adapted. The insert is still mounted from the side without the protective cap, but it is now removed from the side of the protective cap. From there, you have to bend the retaining clips to the side with two screwdrivers as before and can push the insert out backwards. Also the mounting thread has been extended, which now allows mounting with a wall thickness of 1-5 mm.

Product picture:



Initial version:



Changed version:



Disassembly:

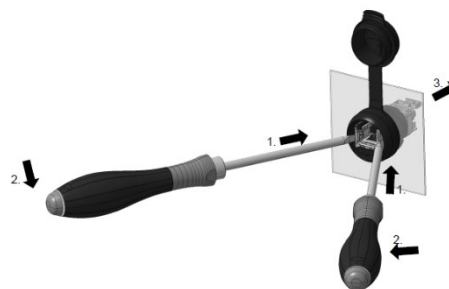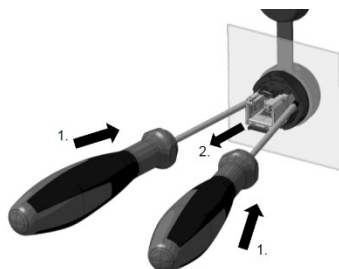

3. Reason for change

The modified version provides a tighter fit of the insert in the housing. The disassembly method is easier for the user. The thread extension allows a more versatile use.

4. Availability

The mentioned service interfaces will be available from April 2023. Due to stock levels of FrontCom® Micro, mixed deliveries may occur. Both variants can be used equally without restrictions.

5. Affected parts

| | |
|------------|---------------------|
| 1018790000 | IE-FCM-RJ45-C |
| 2742310000 | IE-FCM-RJ45-C-X-100 |
| 1124490000 | IE-FCM-NEUTRAL |
| 1018810000 | IE-FCM-RJ45-FJ-A |
| 1018820000 | IE-FCM-RJ45-FJ-B |
| 1018830000 | IE-FCM-RJ45-FJ-P |
| 1018840000 | IE-FCM-USB-A |
| 1222550000 | IE-FCM-USB-AB |
| 1427960000 | IE-FCM-USB-3.0-A |
| 2870820000 | IE-FCM-SP0-C |

6. Data

PCN-number: PCN-PB47-20230103-00-A
date of publishing: 01.03.2023
duration of validity: until further notice
revision number: 00

We hope that the changes will benefit your business and will not affect you in any significant way and apologise in case of any inconvenience caused. Please rest assured that we will do everything possible to achieve this product change as smoothly as possible with minimum or no business disruption.

For further questions or if you need any additional assistance or information, please contact your local sales office directly. All contacts for sales representatives are available here: <http://www.weidmueller.com/contact>

Details of this and any other product changes can also be found on our web page by following the link shown below

<http://www.weidmueller.com/int/service/online-support-and-downloads/product-change-notification>

Best regards

Product Management

Weidmüller Interface GmbH & Co. KG
Klingenbergstraße 26, 32758 Detmold, Germany

Weidmüller – Your partner in Industrial Connectivity
We look forward to sharing ideas with you – **Let's connect.**